



## **MASON INDUSTRIES, Inc.**

*Manufacturers of Vibration Control Products*

350 Rabro Drive 2101 W. Crescent Ave., Suite D  
Hauppauge, NY 11788 Anaheim, CA 92801  
631/348-0282 714/535-2727  
FAX 631/348-0279 FAX 714/535-5738  
Info@Mason-Ind.com Info@MasonAnaheim.com

## **3" (75mm) SLF AND SLFH SPRING MOUNT INSTALLATION INSTRUCTIONS**

**DATE: 3-27-2012**

**DRAWING NO.**

**NOTE: SUPPORTING SURFACES MUST BE FLAT AND LEVEL UNDER MOUNTS.**

- 1. BLOCK UP BASE OR EQUIPMENT TO OPERATING HEIGHT AS SHOWN ON THE DRAWINGS.**
- 2. SET MOUNTS UNDER BRACKET, BASE OR EQUIPMENT HOLES AS INDICATED. FOR SLFH MOUNTS, MARK THE ANCHOR LOCATIONS, REMOVE MOUNTS, INSTALL ANCHORS AND RESET MOUNTS. INSERT LOCKING CAPSCREW (WITH WASHER) THRU THE HOLE AND THREAD INTO THE TAPPED HOLE IN THE ADJUSTMENT BOLT. LEAVE A 1/8" (3mm) CLEARANCE UNDER THE HEAD OF THE CAPSCREW.**
- 3. TAKE 17 COUNTERCLOCKWISE TURNS ON THE ADJUSTING BOLT. REPEAT FOR ALL LOCATIONS MAKING A CIRCUIT AROUND THE EQUIPMENT. IT IS VERY IMPORTANT THAT THE MOUNTS ARE ADJUSTED UNIFORMLY.**
- 4. TAKE ONE ADDITIONAL TURN EQUALLY ON ALL MOUNTS UNTIL BLOCKING CAN BE REMOVED. REMOVE THE BLOCKING.**
- 5. ADDITIONAL TURNS MAY BE TAKEN AT THE LOW CORNER OR SIDE TO LEVEL EQUIPMENT.**
- 6. TIGHTEN CAPSCREWS TO LOCK THE ADJUSTMENT.**

DWN: JT

CHKD:

DATE: 6-20-2001